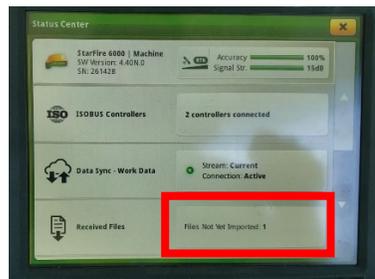# Liquid Rx into a John Deere Gen4
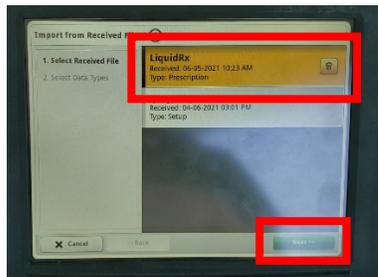
1. First you will need to import the Rx file(s) into the display. Click the Status Center button.

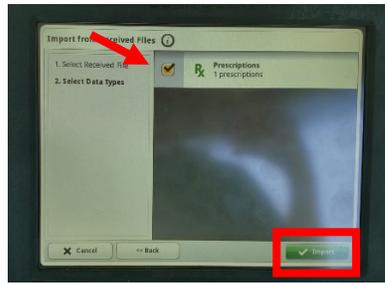2. Click the "Files Not Yet Imported: *X*" button.

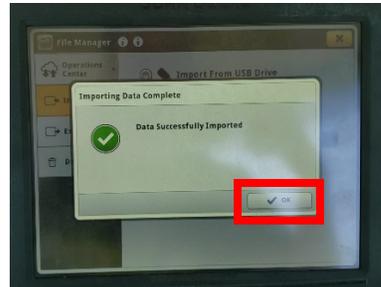3. Select the desired file(s) to import and click the "Next>>" button.

4. On the File Manager screen, select "Import from Received Files" and click the "Next>>" button. *Note: If you have a USB Drive inserted, you can select this option.*

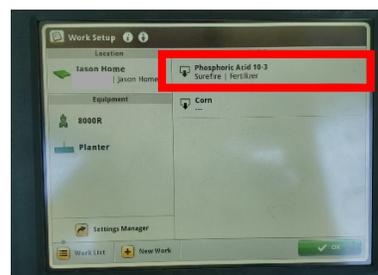5. Select the Prescription(s) you wish to import and click the "Import" button.

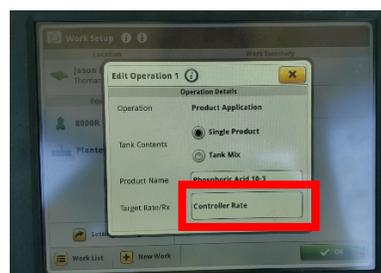6. A notification of successful importation should be shown and click "OK".

7. On the Home page, click the "SETUP" button.

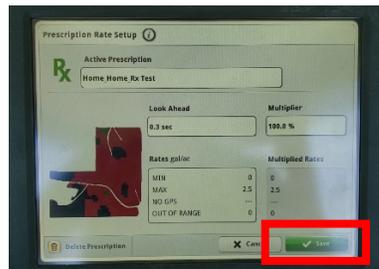8. In the "**Work Setup**" page, click on the liquid product that you wish to variable rate.

9. In the **Edit Operation** screen, select the **Target Rate/Rx** button.

10. Select the Prescription to Assign to the field and click the "OK" button.
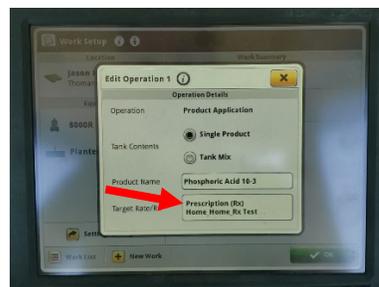

11. On the **Prescription Rate Setup** screen, you should see your prescription as the *Active Prescription*. You can change your Look Ahead & Multiplier to the desired values. Click the **Rates gal/ac** button.
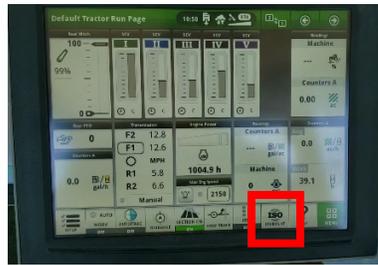

12. Make sure that you have set your **Rate Column, Rate Column Units,** and **No GPS Rate** and click the "OK" button.

13. You should see in the **Edit Operation** screen that the *Target Rate/Rx* box shows your Prescription.
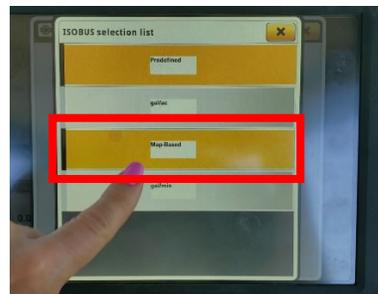
14. On the **Home** screen, click the "Isobus VT" button.

15. Click the "Rate (gal/ac)" dropdown that by default, says *"Predefined."*

16. Select "**Map-based"** from the list.

17. You should see that it is **Map-Based** and you are ready to apply!